



BECHTEL PROJECT NO.: 25161				MACTEC PROJECT NO.: 6468-09-2473				COUNTY: Louisa, VA				GEOLOGIST: A. Mwembeshi			
SITE DESCRIPTION: North Anna 3 Project Supplement 2								DRILLER: R. Landeros/D. Reneau				FLUID LEVEL (ft)			
BORING NO.: M-9				DRILL METHOD: Mud Rotary/Rock Core				DRILL MACHINE: CME-550X (ATL)				0 HR.		NA	
GROUND ELEV.: 327.3 ft (NAVD88)				NORTHING: 3,909,334 US ft (NAD83)				EASTING: 11,685,946 US ft (NAD83)				24 HR.		4.0	
TOTAL DEPTH: 153.6 ft		SAMPLE METHODS: ASTM D 1586-08a; 2488-09a; 2113-08; 6032-08						ROD TYPE: AWJ		HAMMER (ID):140-lb. Auto (MEC-05)					
DATE STARTED: 9/1/09		COMPLETED: 9/4/09		HOLE DIA.: 3"		CASING DEPTH: 105.0 ft		CORE SIZE: NQ3		BITS USED: 2-7/8" Drag					
ELEV. (ft)	DEPTH (ft)	BLOW COUNT			BLOWS PER FOOT						SAMP. NO.	MOI	LOG	SOIL AND ROCK DESCRIPTION	
		0.5ft	0.5ft	0.5ft	0	20	40	60	80	100					
327.3					Ground Surface									327.3	0.0
319.2	8.1													319.2	8.1
316.8	10.5	5	4	5							SS-1				
314.4	12.9	3	2	5							SS-2				
311.9	15.4	5	6	5							SS-3				
309.4	17.9	4	5	4							SS-4				
304.4	22.9	5	6	6							SS-5				
299.5	27.8	5	6	6							SS-6				
294.5	32.8	5	7	7							SS-7				
288.6	38.7	5	8	8							SS-8				
283.6	43.7	8	9	9							SS-9				
279.5	47.8	5	11	23							SS-10				
274.6	52.7	15	18	22							SS-11				
269.6	57.7	16	19	20							SS-12				
264.6	62.7	27	40	43							SS-13				
259.6	67.7	20	26	45							SS-14				
254.6	72.7	49	50/0.3								SS-15				
											SS-16				

NORTH ANNA 3 BORE NORTH ANNA 3 PROJECT.GPJ NORTH ANNA 3.GDT 12/4/09



SHEET 2 OF 3

BECHTEL PROJECT NO.: 25161				MACTEC PROJECT NO.: 6468-09-2473				COUNTY: Louisa, VA				GEOLOGIST: A. Mwembeshi			
SITE DESCRIPTION: North Anna 3 Project Supplement 2								DRILLER: R. Landeros/D. Reneau				FLUID LEVEL (ft)			
BORING NO.: M-9				DRILL METHOD: Mud Rotary/Rock Core				DRILL MACHINE: CME-550X (ATL)				0 HR. NA			
GROUND ELEV.: 327.3 ft (NAVD88)				NORTHING: 3,909,334 US ft (NAD83)				EASTING: 11,685,946 US ft (NAD83)				24 HR. 4.0			
TOTAL DEPTH: 153.6 ft				SAMPLE METHODS: ASTM D 1586-08a; 2488-09a; 2113-08; 6032-08				ROD TYPE: AWJ				HAMMER (ID):140-lb. Auto (MEC-05)			
DATE STARTED: 9/1/09				COMPLETED: 9/4/09		HOLE DIA.: 3"		CASING DEPTH: 105.0 ft		CORE SIZE: NQ3		BITS USED: 2-7/8" Drag			
ELEV.	DEPTH	BLOW COUNT			BLOWS PER FOOT						SAMP.	LOG	SOIL AND ROCK DESCRIPTION		
(ft)	(ft)	0.5ft	0.5ft	0.5ft	0	20	40	60	80	100	NO.				MOI
252.5					Continued from previous page										
249.6	77.7													WEATHERED ROCK: Severely weathered BIOTITE QUARTZ GNEISS (Sampled as Silty SAND (SM), very pale brown (10YR 8/3 & 10YR 7/3), very dense, moist, medium grained sand, trace mica, few to little rock fragments) (continued)	
		39	50/0.4									SS-17			
244.6	82.7														
		50/0.4										SS-18			
239.6	87.7														
		50/0.4										SS-19			
234.6	92.7														
		50/0.4										SS-20			
229.6	97.7														
		50/0.2										SS-21			
223.2	104.1													107.8 ft: Grayish brown (10YR 5/2)	
		50/0.1										SS-22			
219.5	107.8														
		50/0.2										SS-23			
214.5	112.8													112.8 ft: Pale yellow (2.5YR 7/4)	
		50/0.2										SS-24			
209.4	117.9													117.9 ft: Brown (10YR 5/3)	
		35	50/0.4									SS-25			
205.4	121.9													121.9 ft: Bit Refusal; SPT refusal with no penetration	
		50/0.0										SS-26			
														HARD ROCK: Light to dark gray, slightly weathered to fresh, very close to wide fracturing, medium hard to hard, BIOTITE QUARTZ GNEISS	

NORTH ANNA 3 BORE NORTH ANNA 3 PROJECT.GPJ NORTH ANNA 3.GDT 12/4/09



SHEET 3 OF 3

BECHTEL PROJECT NO.: 25161				MACTEC PROJECT NO.: 6468-09-2473				COUNTY: Louisa, VA				GEOLOGIST: A. Mwembeshi			
SITE DESCRIPTION: North Anna 3 Project Supplement 2								DRILLER: R. Landeros/D. Reneau				FLUID LEVEL (ft)			
BORING NO.: M-9				DRILL METHOD: Mud Rotary/Rock Core				DRILL MACHINE: CME-550X (ATL)				0 HR. NA			
GROUND ELEV.: 327.3 ft (NAVD88)				NORTHING: 3,909,334 US ft (NAD83)				EASTING: 11,685,946 US ft (NAD83)				24 HR. 4.0			
TOTAL DEPTH: 153.6 ft				SAMPLE METHODS: ASTM D 1586-08a; 2488-09a; 2113-08; 6032-08				ROD TYPE: AWJ				HAMMER (ID):140-lb. Auto (MEC-05)			
DATE STARTED: 9/1/09				COMPLETED: 9/4/09				HOLE DIA.: 3"				CASING DEPTH: 105.0 ft			
								CORE SIZE: NQ3				BITS USED: 2-7/8" Drag			

ELEV. (ft)	DEPTH (ft)	BLOW COUNT			BLOWS PER FOOT						SAMP. NO.	LOG	SOIL AND ROCK DESCRIPTION
		0.5ft	0.5ft	0.5ft	0	20	40	60	80	100			
177.7					Continued from previous page								
													
													173.7 153.6 Boring and coring terminated at 153.6 feet. Boring closed by tremie method with cement-bentonite grout. 24 hour water level measured on 9/04/2009 prior to drilling. Borehole was at a depth of 121.9 feet.

NORTH ANNA 3 BORE NORTH ANNA 3 PROJECT.GPJ NORTH ANNA 3.GDT 12/4/09




SHEET 1 OF 1


BECHTEL PROJECT NO.: 25161	MACTEC PROJECT NO.: 6468-09-2473	COUNTY: Louisa, VA	GEOLOGIST: A. Mwembeshi
SITE DESCRIPTION: North Anna 3 Project Supplement 2		DRILLER: R. Landeros/D. Reneau	FLUID LEVEL (ft)
BORING NO.: M-9	DRILL METHOD: Mud Rotary/Rock Core	DRILL MACHINE: CME-550X (ATL)	0 HR. NA
GROUND ELEV.: 327.3 ft (NAVD88)	NORTHING: 3,909,334 US ft (NAD83)	EASTING: 11,685,946 US ft (NAD83)	24 HR. 4.0
TOTAL DEPTH: 153.6 ft	SAMPLE METHODS: ASTM D 1586-08a; 2488-09a; 2113-08; 6032-08		HAMMER (ID): 140-lb. Auto (MEC-05)
DATE STARTED: 9/1/09	COMPLETED: 9/4/09	CASING DEPTH: 105.0 ft	CORE BARREL TYPE: Wireline NQ3 Triple Tube, series 6 bit

ELEV. (ft)	DEPTH (ft)	RUN (ft)	DRILL RATE (Min/ft)	RUN		SAMP. NO.	STRATA		LOG	DESCRIPTION AND REMARKS
				REC. (ft) %	RQD (ft) %		REC. (ft) %	RQD (ft) %		
										Begin Coring @ 98.6 ft
228.7	98.6	4.8	0:39 0:47 0:33 0:39 0:37	(0.0) 0%	(0.0) 0%	RUN 1	(0.0) 0%	(0.0) 0%		WEATHERED ROCK: Severely weathered BIOTITE QUARTZ GNEISS (Sampled as Silty SAND (SM), very pale brown (10YR 8/3 & 10YR 7/3), very dense, moist, medium grained sand, trace mica, few to little rock fragments) (continued) (No Core Recovery - cont. boring with mud rotary and SPT sampling to bit refusal)
223.9	103.4		N=50/0.1			SS-22				
			N=50/0.2			SS-23				107.8 ft: Grayish brown (10YR 5/2)
			N=50/0.2			SS-24				112.8 ft: Pale yellow (2.5YR 7/4)
			N=50/0.4			SS-25				117.9 ft: Brown (10YR 5/3)
										121.9 ft: Bit Refusal; SPT refusal with no penetration
205.4	121.9	1.7	N=50/0.0 3:09	(1.2) 71%	(0.0) 0%	RUN 2	(31.2) 98%	(28.4) 90%		HARD ROCK: Light to dark gray, slightly weathered to fresh, very close to wide fracturing, medium hard to hard, BIOTITE QUARTZ GNEISS (2 joints at 30°, tight) (3 joints at 45°, tight)
203.7	123.6	5.0	1:41/0.7 1:41 1:52 3:28 3:01 4:23	(5.0) 100%	(4.6) 92%	RUN 3				(3 joints at 90°, open; several mechanical fractures)
198.7	128.6	5.0	5:15 8:34 5:43 5:57 12:12	(5.0) 100%	(5.0) 100%	RUN 4				(3 joints at 30°, open with trace clay; 1 joint at 45°)
193.7	133.6	5.0	1:17 1:47 2:02 0:45 1:46	(5.0) 100%	(4.2) 84%	RUN 5				(1 joint at 30°, tight with trace orange staining)
188.7	138.6	5.0	1:51 1:35 2:04 2:47 4:29	(5.0) 100%	(5.0) 100%	RUN 6				(3 joints at 15°, tight with trace brown-orange staining)
183.7	143.6	5.0	2:45 4:05 2:43 2:12 3:08	(5.0) 100%	(4.7) 94%	RUN 8				(2 joints at 45°, tight; several mechanical fractures; quartz vein with trace feldspar, calcite, and muscovite from 151.6 to 153.6 feet)
178.7	148.6	5.0	1:43 2:11 2:09 2:50 2:54	(5.0) 100%	(4.9) 98%	RUN 9				Boring and coring terminated at 153.6 feet.
173.7	153.6									Boring closed by tremie method with cement-bentonite grout. 24 hour water level measured on 9/04/2009 prior to drilling. Borehole was at a depth of 121.9 feet.

NORTH ANNA 3 CORE NORTH ANNA 3 PROJECT.GPJ NORTH ANNA 3.GDT 12/4/09

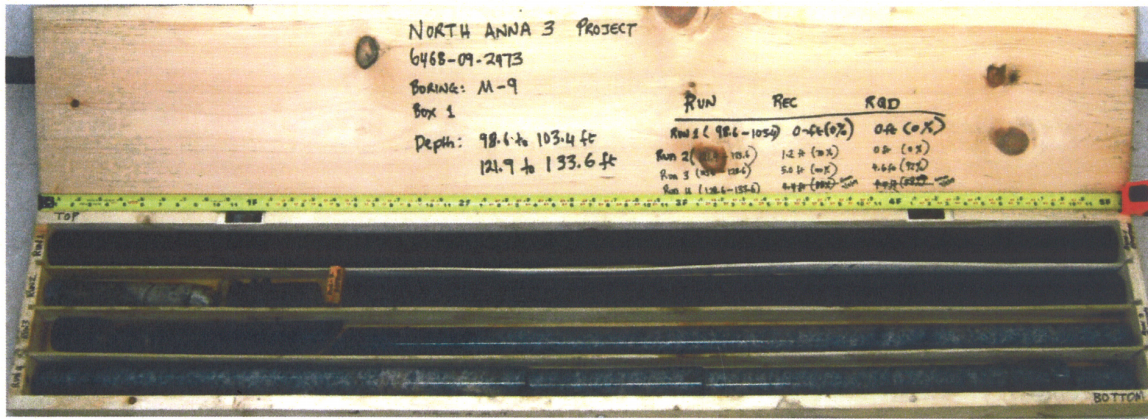

M-9 - Box 1

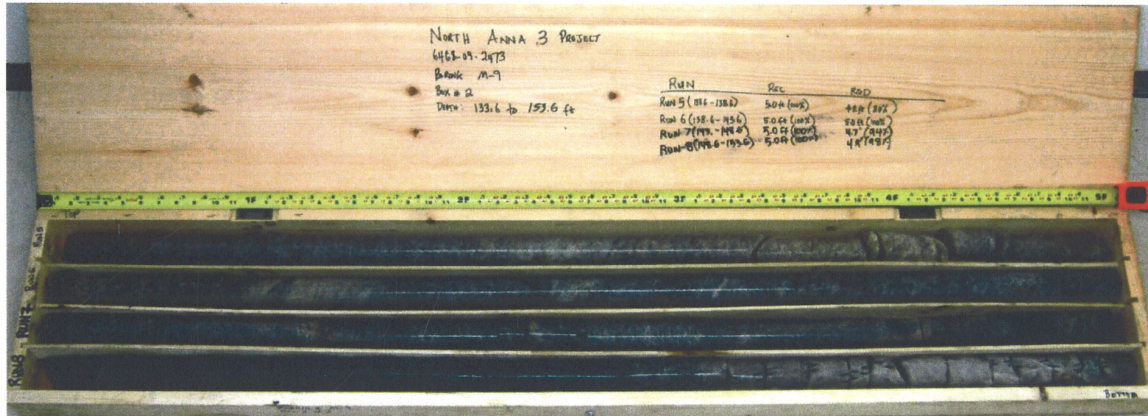

M-9 - Box 2



BECHTEL PROJECT NO.: 25161					MACTEC PROJECT NO.: 6468-09-2473					COUNTY: Louisa, VA					GEOLOGIST: K. Lloyd				
SITE DESCRIPTION: North Anna 3 Project Supplement 2										DRILLER: D. White/O. Smith					FLUID LEVEL (ft) 0 HR. NA 24 HR. 26.0				
BORING NO.: M-10 (DH)					DRILL METHOD: Mud Rotary/Rock Core					DRILL MACHINE: CME-55LC Track (RAL)									
GROUND ELEV.: 323.6 ft (NAVD88)					NORTHING: 3,909,244 US ft (NAD83)					EASTING: 11,685,962 US ft (NAD83)									
TOTAL DEPTH: 201.9 ft			SAMPLE METHODS: ASTM D 1586-08a; 2488-09a; 2113-08; 6032-08							ROD TYPE: AWJ			HAMMER (ID):140-lb. Auto (MEC-02)						
DATE STARTED: 9/1/09			COMPLETED: 9/9/09			HOLE DIA.: 4"			CASING DEPTH: 89.8 ft			CORE SIZE: HQ3			BITS USED: 3-7/8" Tri-Cone				
ELEV. (ft)	DEPTH (ft)	BLOW COUNT			BLOWS PER FOOT					SAMP. NO.	MOI	L O G	SOIL AND ROCK DESCRIPTION						
		0.5ft	0.5ft	0.5ft	0	20	40	60	80	100									
323.6					Ground Surface								323.6	0.0					
														No sampling from 0.0 to 8.8 feet due to soft dig utility clearance by Dominion Personnel.					
314.8	8.8	6	5	5						SS-1			314.8	8.8					
311.9	11.7	3	4	5						SS-2				RESIDUAL SOIL: Silty SAND (SM), yellowish red (5YR 5/6), loose, moist, trace to few black stains, relict rock fabric					
309.3	14.3	4	3	5						SS-3				11.7 ft: Red (2.5YR 4/8), little to some mica					
														14.3 ft: Dark red (2.5YR 3/6), trace black stains					
304.4	19.2	4	4	5						SS-4				19.2 ft: Strong brown (7.5YR 4/6)					
299.4	24.2	2	3	4						SS-5									
294.4	29.2	2	3	5						SS-6				29.2 ft: Dark yellowish brown (10YR 4/6)					
289.5	34.1	2	8	11						SS-7				34.1 ft: Brownish yellow (10YR 6/8), medium dense					
284.5	39.1	7	3	5						SS-8				39.1 ft: Yellowish brown (10YR 5/6), loose, fine to coarse grained sand, trace to few black stains					
279.5	44.1	3	3	7						SS-9				44.1 ft: Light yellowish brown (10YR 6/4)					
274.5	49.1	13	15	17						SS-10				49.1 ft: Very pale brown (10YR 7/3), dense					
269.5	54.1	15	15	17						SS-11									
264.5	59.1	20	25	36						SS-12				59.1 ft: Very pale brown (10YR 8/2), very dense, coarse grained sand, trace mica					
259.5	64.1	46	50/0.5							SS-13				WEATHERED ROCK: Severely weathered QUARTZ GNEISS (Sampled as Silty SAND (SM), very pale brown (10YR 8/2), very dense, moist, coarse grained sand, trace mica, few to little rock fragments)					
254.5	69.1	6	20	36						SS-14				RESIDUAL SOIL: Silty SAND (SM), brownish yellow (10YR 6/6), very dense, moist, little to some mica, fine grained sand, relict rock fabric					
249.5	74.1																		

NORTH ANNA 3 BORE, NORTH ANNA 3 PROJECT.GPJ, NORTH ANNA 3.GDT, 12/4/09

[illegible]



SHEET 3 OF 3

BECHTEL PROJECT NO.: 25161		MACTEC PROJECT NO.: 6468-09-2473		COUNTY: Louisa, VA		GEOLOGIST: K. Lloyd								
SITE DESCRIPTION: North Anna 3 Project Supplement 2				DRILLER: D. White/O. Smith		FLUID LEVEL (ft)								
BORING NO.: M-10 (DH)		DRILL METHOD: Mud Rotary/Rock Core		DRILL MACHINE: CME-55LC Track (RAL)		0 HR. NA								
GROUND ELEV.: 323.6 ft (NAVD88)		NORTHING: 3,909,244 US ft (NAD83)		EASTING: 11,685,962 US ft (NAD83)		24 HR. 26.0								
TOTAL DEPTH: 201.9 ft		SAMPLE METHODS: ASTM D 1586-08a; 2488-09a; 2113-08; 6032-08		ROD TYPE: AWJ		HAMMER (ID): 140-lb. Auto (MEC-02)								
DATE STARTED: 9/1/09		COMPLETED: 9/9/09		HOLE DIA.: 4"		CASING DEPTH: 89.8 ft								
				CORE SIZE: HQ3		BITS USED: 3-7/8" Tri-Cone								
ELEV. (ft)	DEPTH (ft)	BLOW COUNT			BLOWS PER FOOT					SAMP. NO.	LOG	SOIL AND ROCK DESCRIPTION		
		0.5ft	0.5ft	0.5ft	0	20	40	60	80	100				
174.0					Continued from previous page									
											RS-3		HARD ROCK: Light gray to gray, slightly weathered to fresh, close to wide fracturing, hard to very hard, BIOTITE QUARTZ GNEISS (continued)	
											RS-4			
											RS-5			
													124.7	198.9
													121.7	201.9
													HARD ROCK: Dark gray, very slightly weathered, close to moderately close fracturing, very hard, QUARTZ BIOTITE GNEISS	
													Boring and coring terminated at 201.9 feet.	
													Boring closed by tremie method with cement-bentonite grout.	
													24 hour water level measured on 9/09/2009 prior to drilling. Borehole was at a depth of 196.6 feet.	

NORTH ANNA 3 BORE NORTH ANNA 3 PROJECT.GPJ NORTH ANNA 3.GDT 12/4/09



SHEET 1 OF 2

BECHTEL PROJECT NO.: 25161	MACTEC PROJECT NO.: 6468-09-2473	COUNTY: Louisa, VA	GEOLOGIST: K. Lloyd
SITE DESCRIPTION: North Anna 3 Project Supplement 2		DRILLER: D. White/O. Smith	FLUID LEVEL (ft)
BORING NO.: M-10 (DH)	DRILL METHOD: Mud Rotary/Rock Core	DRILL MACHINE: CME-55LC Track (RAL)	0 HR. NA
GROUND ELEV.: 323.6 ft (NAVD88)	NORTHING: 3,909,244 US ft (NAD83)	EASTING: 11,685,962 US ft (NAD83)	24 HR. 26.0
TOTAL DEPTH: 201.9 ft	SAMPLE METHODS: ASTM D 1586-08a; 2488-09a; 2113-08; 6032-08		HAMMER (ID): 140-lb. Auto (MEC-02)
DATE STARTED: 9/1/09	COMPLETED: 9/9/09	CASING DEPTH: 89.8 ft	CORE BARREL TYPE: Wireline HQ3 Triple Tube, series 6 & 10 bits

ELEV. (ft)	DEPTH (ft)	RUN (ft)	DRILL RATE (Min/ft)	REC. (%)	RQD (%)	SAMP. NO.	REC. (%)	RQD (%)	LOG	DESCRIPTION AND REMARKS
										Begin Coring @ 89.8 ft
233.8	89.8	2.0	1:37	(0.0)	(0.0)	RUN 1	(0.0)	(0.0)		WEATHERED ROCK: Severely weathered BIOTITE QUARTZ GNEISS (Sampled as Silty SAND (SM), very pale brown (10YR 7/4 and 10YR 7/3), very dense, moist, fine to coarse grained sand, little mica, little rock fragments) (continued) (No Recovery) (No Recovery) (No Recovery) (No Recovery)
231.8	91.8		1:15	0%	0%		0%	0%		
		5.0	0:41	(0.0)	(0.0)	RUN 2				
			0:32	0%	0%					
			0:39							
226.8	96.8		0:45							
		5.0	0:46	(0.0)	(0.0)	RUN 3				
			1:15	0%	0%					
			0:32							
			0:27							
221.8	101.8		1:07							
			1:00							
221.0	102.6	3.7	N=50/0.5	(0.0)	(0.0)	SS-19 RUN 4				(No Recovery)
			1:17	0%	0%					
			0:33							
217.3	106.3		0:42							
			0:41/0.7	(0.5)	(0.0)	SS-20 RUN 5				
217.1	106.5	4.8	N=50/0.2	10%	0%					
			0:42							
			0:45							
			0:39							
			0:42							
212.3	111.3		0:45/0.8	(5.0)	(3.3)	RUN 6	(5.5)	(3.3)		HARD ROCK: Light tan with orange staining, moderately severe to moderately weathered, close fracturing, medium hard to moderately hard, BIOTITE QUARTZ GNEISS (2 joints at 30°) (4 joints at 20-30°, open with orange staining; 2 joints at 60-70°, open with brown-orange staining)
		5.0	N=50/0.0	100%	66%		100%	60%		
			1:37							
			1:05							
			1:14							
			1:38							
207.3	116.3		1:31	(4.5)	(3.6)	RUN 7 RS-1	(27.6)	(22.0)		HARD ROCK: Light yellowish brown with orange staining, moderately to slightly weathered, close to moderately close fracturing, moderately hard to hard, BIOTITE QUARTZ GNEISS (4 joints at 30°, open with trace clay and orange staining) (4 joints at 30°, open with orange stain; 2 joints at 60-70°, open with trace clay)
		5.0	1:21	90%	72%		97%	77%		
			1:51							
			1:42							
			1:25							
			1:56							
202.3	121.3		2:07	(4.8)	(4.0)	RUN 8				(3 joints at 20-30°, open with trace clay; 2 joints at 45°, open with trace clay)
		5.0	2:09	96%	80%					
			2:21							
			2:39							
			2:24							
197.3	126.3		2:48	(5.0)	(4.1)	RUN 9				(3 joints at 30°, tight)
		5.0	2:33	100%	82%					
			2:17							
			2:12							
			2:31							
192.3	131.3		2:14	(5.0)	(4.2)	RUN 10				(2 joints at 30°)
		5.0	2:49	100%	84%					
			3:15							
			2:36							
			2:45							
187.3	136.3		2:06	(5.0)	(4.1)	RUN 11				(4 joints at 30°, tight)
		5.0	2:25	100%	82%					
			2:20							
			2:18							
			2:39							
182.3	141.3		2:18	(3.3)	(2.0)	RUN 12				
		3.5	2:40	94%	57%					
			2:05							
178.8	144.8		3:04/0.5	(1.8)	(1.8)	RUN 13	(53.0)	(50.5)		HARD ROCK: Light gray to gray, slightly weathered to fresh, close to wide fracturing, hard to very hard, BIOTITE QUARTZ GNEISS (2 joints at 20°, tight with trace orange staining) (4 joints at 30°, tight)
		1.8	1:34	100%	100%		98%	93%		
177.0	146.6		3:05/0.8	(5.0)	(3.2)	RUN 14				(3 joints at 0-10°, tight; 1 joint at 60°, tight)
		5.0	3:28	100%	64%					
			4:31							
			3:38							
			2:15							
			2:06							
172.0	151.6		4:20	(5.0)	(4.7)	RUN 15				(fractures are mechanical)
		5.0	4:58	100%	94%					
			5:05							
			5:50							
			3:49							
167.0	156.6		5:20	(5.0)	(5.0)	RUN 16				
		5.0	6:36	100%	100%					
			5:28							
			6:02							
			4:58							
162.0	161.6		4:03	(4.7)	(4.5)	RUN 17				(4 joints at 30°, tight)
		5.0	5:32	94%	90%					
			4:47							


NORTH ANNA 3 CORE NORTH ANNA 3 PROJECT.GPJ NORTH ANNA 3.GDT 12/4/09




SHEET 2 OF 2

BECHTEL PROJECT NO.: 25161				MACTEC PROJECT NO.: 6468-09-2473				COUNTY: Louisa, VA		GEOLOGIST: K. Lloyd	
SITE DESCRIPTION: North Anna 3 Project Supplement 2						DRILLER: D. White/O. Smith				FLUID LEVEL (ft) 0 HR. NA 24 HR. 26.0	
BORING NO.: M-10 (DH)				DRILL METHOD: Mud Rotary/Rock Core		DRILL MACHINE: CME-55LC Track (RAL)					
GROUND ELEV.: 323.6 ft (NAVD88)				NORTHING: 3,909,244 US ft (NAD83)		EASTING: 11,685,962 US ft (NAD83)					
TOTAL DEPTH: 201.9 ft		SAMPLE METHODS: ASTM D 1586-08a; 2488-09a; 2113-08; 6032-08						HAMMER (ID): 140-lb. Auto (MEC-02)			
DATE STARTED: 9/1/09		COMPLETED: 9/9/09		CASING DEPTH: 89.8 ft		CORE BARREL TYPE: Wireline HQ3 Triple Tube, series 6 & 10 bits					
Continued from previous page											
ELEV. (ft)	DEPTH (ft)	RUN (ft)	DRILL RATE (Min/ft)	REC. (ft) %	RQD (ft) %	SAMP. NO.	REC. (ft) %	RQD (ft) %	L O G	DESCRIPTION AND REMARKS	
157.0	166.6	5.0	3:58 3:18	(5.0) 100%	(5.0) 100%	RUN 18				HARD ROCK: Light gray to gray, slightly weathered to fresh, close to wide fracturing, hard to very hard, BIOTITE QUARTZ GNEISS (continued) (1 joint at 30°, open with trace clay)	
152.0	171.6	5.0	4:32 6:20 7:15 11:34 10:45	(5.0) 100%	(5.0) 100%	RUN 19				(2 joints at 10-20°, tight with trace orange stain)	
147.0	176.6	5.0	3:38 4:45 6:08 10:32 8:02	(5.0) 100%	(4.8) 96%	RUN 20 RS-4				(3 joints at 10-20°, tight to open with trace clay and orange stain)	
142.0	181.6	5.0	4:21 6:05 5:52 8:42 10:45	(5.0) 100%	(4.7) 94%	RUN 21				(2 joints at 10-20°, tight)	
137.0	186.6	5.0	4:02 6:42 3:16 3:29 2:40	(5.0) 100%	(5.0) 100%	RUN 22				(No joints)	
132.0	191.6	5.0	3:15 3:45 4:17 4:12 4:17	(4.8) 96%	(4.8) 96%	RUN 23				(No joints)	
127.0	196.6	2.3	4:56 5:43 4:54 5:17 4:18	(2.0) 87%	(2.0) 87%	RUN 24 RS-5				(No joints)	
124.7	198.9	3.0	3:16 3:10 3:25/0.3	(3.0) 100%	(2.8) 93%	RUN 25	(3.0) 100%	(2.8) 93%		124.7 198.9	
121.7	201.9		3:37 3:37 2:52							121.7 201.9	
HARD ROCK: Dark gray, very slightly weathered, close to moderately close fracturing, very hard, QUARTZ BIOTITE GNEISS (2 joints at 20-30°, tight) Boring and coring terminated at 201.9 feet. Boring closed by tremie method with cement-bentonite grout. 24 hour water level measured on 9/09/2009 prior to drilling. Borehole was at a depth of 196.6 feet.											


NORTH ANNA 3 CORE NORTH ANNA 3 PROJECT.GPJ NORTH ANNA 3.GDT 12/4/09

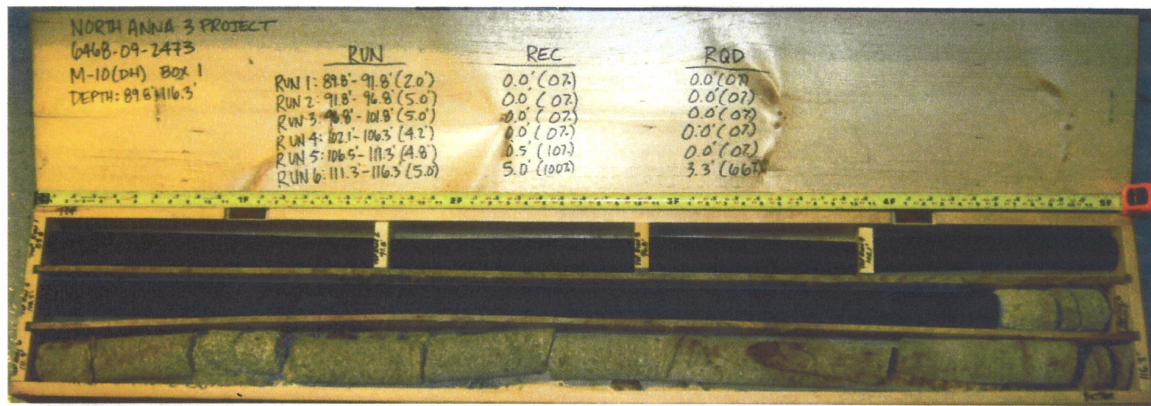


M-10(DH) - Box 1

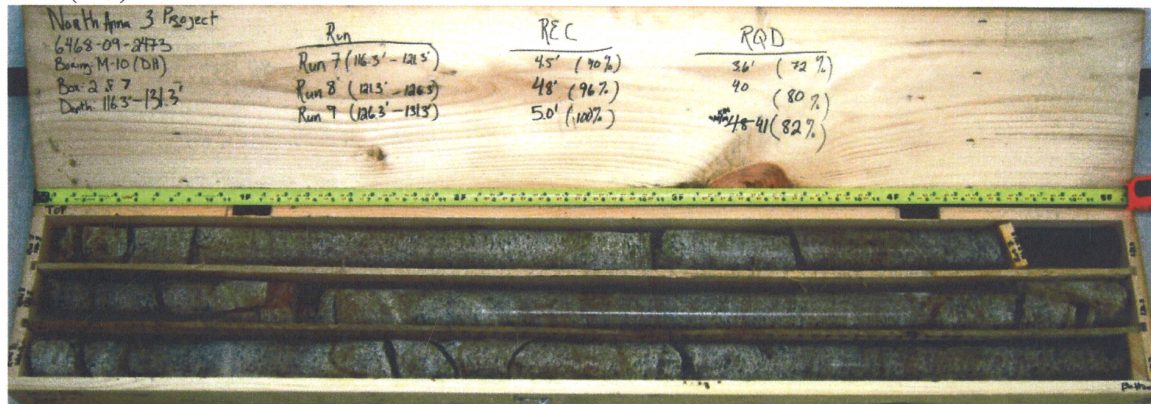


M-10(DH) - Box 2

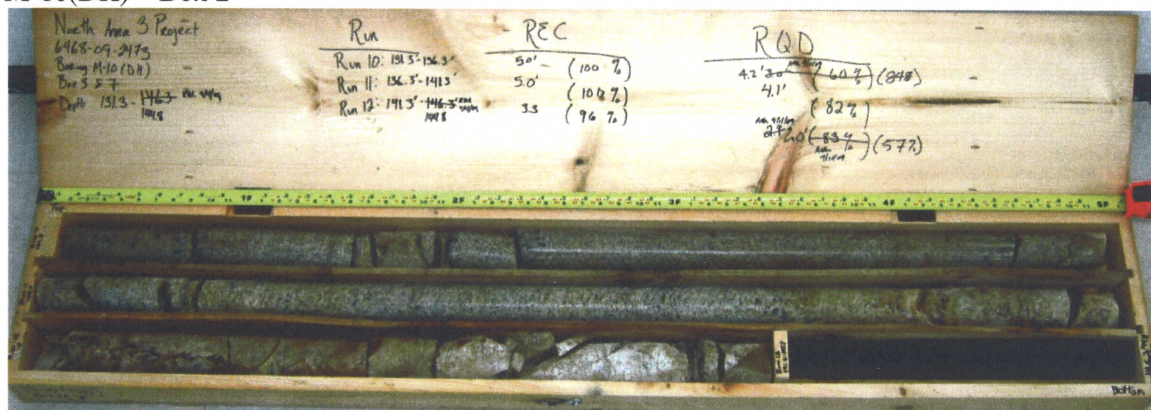


M-10(DH) - Box 3

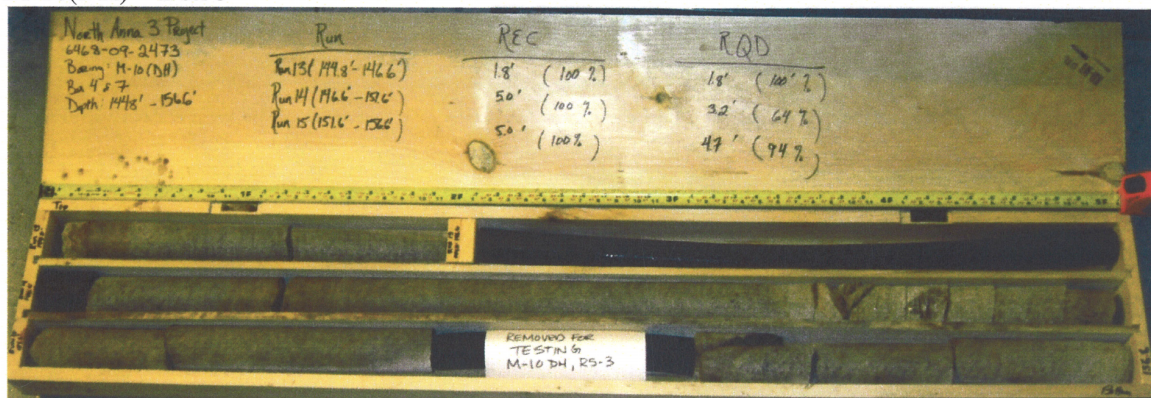


M-10(DH) - Box 4

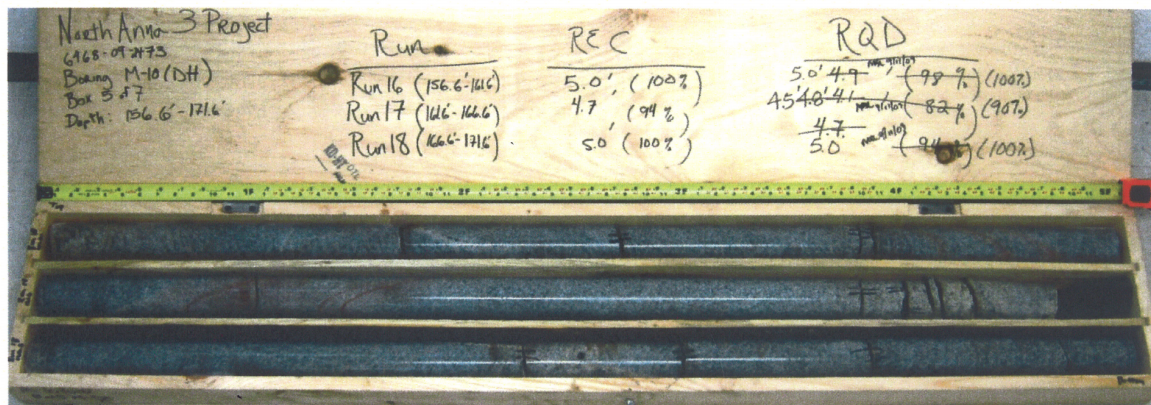

M-10(DH) - Box 5

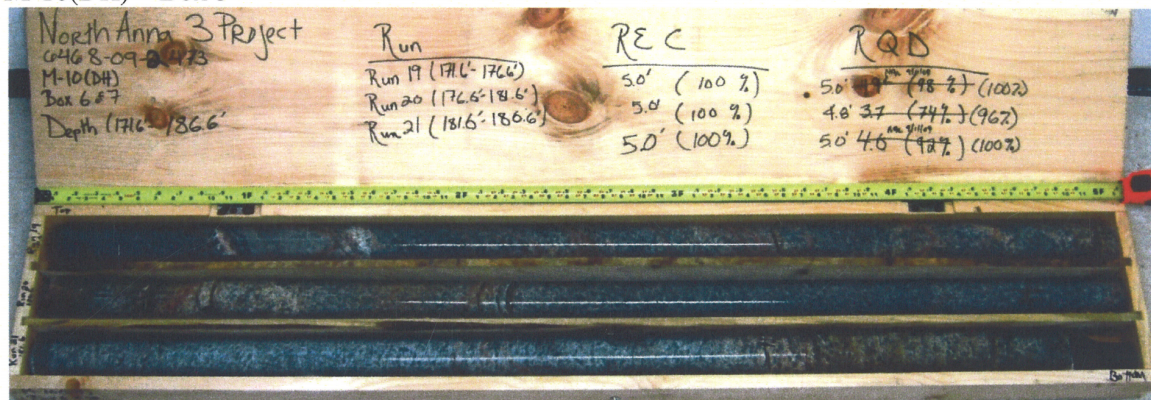

M-10(DH) - Box 6

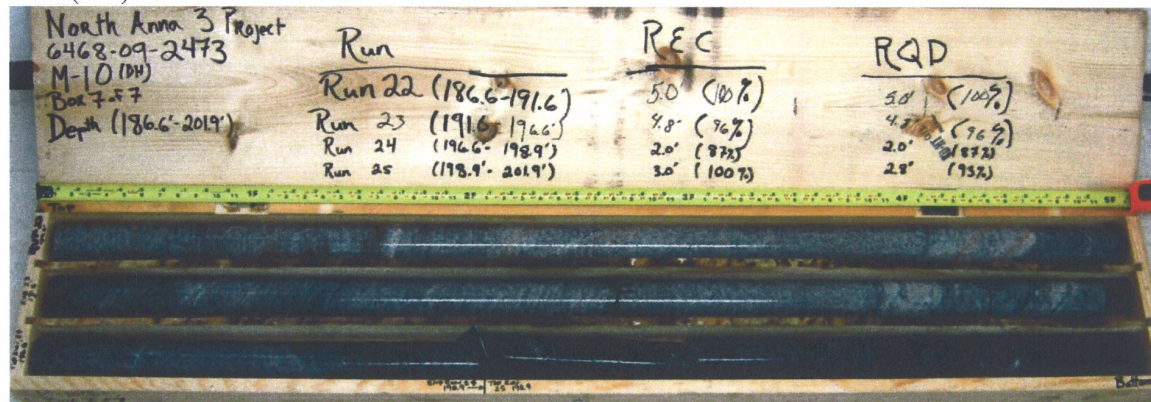

M-10(DH) - Box 7



BECHTEL PROJECT NO.: 25161				MACTEC PROJECT NO.: 6468-09-2473				COUNTY: Louisa, VA				GEOLOGIST: C. Baldwin			
SITE DESCRIPTION: North Anna 3 Project Supplement 2								DRILLER: P. Pitts/J. Tucker				FLUID LEVEL (ft)			
BORING NO.: M-11				DRILL METHOD: Mud Rotary				DRILL MACHINE: CME-55 Trailer (RAL)				0 HR.		ND	
GROUND ELEV.: 325.9 ft (NAVD88)				NORTHING: 3,909,352 US ft (NAD83)				EASTING: 11,686,039 US ft (NAD83)				24 HR.		ND	
TOTAL DEPTH: 148.7 ft		SAMPLE METHODS: ASTM D 1586-08a; 2488-09a; 2113-08; 6032-08						ROD TYPE: AWJ		HAMMER (ID):140-lb. Auto (MEC-425)					
DATE STARTED: 9/1/09		COMPLETED: 9/4/09		HOLE DIA.: 3"		CASING DEPTH: 8.4 ft		CORE SIZE: NA		BITS USED: 2-7/8" Tri-Cone					
ELEV. (ft)	DEPTH (ft)	BLOW COUNT			BLOWS PER FOOT						SAMP. NO.	MOI	LOG	SOIL AND ROCK DESCRIPTION	
		0.5ft	0.5ft	0.5ft	0	20	40	60	80	100					
325.9					Ground Surface									325.9	0.0
														No sampling from 0.0 to 8.4 feet due to soft dig utility clearance by Dominion Personnel.	
317.5	8.4	4	5	6							SS-1			317.5	8.4
315.0	10.9	4	5	5							SS-2			RESIDUAL SOIL: Silty SAND (SM), reddish yellow (7.5YR 7/6), medium dense, moist, fine to medium grained sand, little mica, relict rock fabric	
312.5	13.4	4	6	5							SS-3			10.9 ft: Loose	
310.0	15.9	5	6	6							SS-4			13.4 ft: Medium dense	
307.4	18.5	4	6	6							SS-5			15.9 ft: Yellow (10YR 8/6), fine to coarse grained sand	
302.0	23.9	6	8	8							SS-6				
297.0	28.9	6	11	12							SS-7				
292.0	33.9	5	6	6							SS-8			33.9 ft: Reddish yellow (7.5YR 7/6)	
287.0	38.9	4	7	8							SS-9				
282.0	43.9	6	7	8							SS-10				
277.3	48.6	8	7	6							SS-11			48.6 ft: Reddish yellow (5YR 7/6)	
272.3	53.6	8	14	13							SS-12				
267.3	58.6	11	13	17							SS-13			58.6 ft: Very pale brown (10YR 7/3)	
262.3	63.6	12	23	25							SS-14			63.6 ft: Reddish yellow (7.5YR 6/6), dense	
257.3	68.6	14	21	19							SS-15			68.6 ft: Pale yellow (5Y 8/3)	
252.3	73.6	9	11	24							SS-16				

NORTH ANNA 3 BORE NORTH ANNA 3 PROJECT.GPJ NORTH ANNA 3.GDT 12/4/09



SHEET 2 OF 3

BECHTEL PROJECT NO.: 25161					MACTEC PROJECT NO.: 6468-09-2473					COUNTY: Louisa, VA			GEOLOGIST: C. Baldwin		
SITE DESCRIPTION: North Anna 3 Project Supplement 2										DRILLER: P. Pitts/J. Tucker				FLUID LEVEL (ft) 0 HR. ND 24 HR. ND	
BORING NO.: M-11					DRILL METHOD: Mud Rotary					DRILL MACHINE: CME-55 Trailer (RAL)					
GROUND ELEV.: 325.9 ft (NAVD88)					NORTHING: 3,909,352 US ft (NAD83)					EASTING: 11,686,039 US ft (NAD83)					
TOTAL DEPTH: 148.7 ft			SAMPLE METHODS: ASTM D 1586-08a; 2488-09a; 2113-08; 6032-08							ROD TYPE: AWJ		HAMMER (ID): 140-lb. Auto (MEC-425)			
DATE STARTED: 9/1/09			COMPLETED: 9/4/09			HOLE DIA.: 3"		CASING DEPTH: 8.4 ft		CORE SIZE: NA		BITS USED: 2-7/8" Tri-Cone			
ELEV. (ft)	DEPTH (ft)	BLOW COUNT 0.5ft 0.5ft 0.5ft			BLOWS PER FOOT 0 20 40 60 80 100					SAMP. NO.	▼ MOI	L O G	SOIL AND ROCK DESCRIPTION		
251.1					Continued from previous page										
247.3	78.6												73.6 ft: Pale yellow (2.5YR 7/3) RESIDUAL SOIL: Silty SAND (SM), reddish yellow (7.5YR 7/6), medium dense, moist, fine to medium grained sand, little mica, relict rock fabric (continued)		
242.3	83.6	11	16	20						SS-17			83.6 ft: Yellow (10YR 8/6), medium dense		
237.3	88.6	9	10	19						SS-18					
232.3	93.6	10	11	14						SS-19					
227.3	98.6	15	27	26						SS-20			93.6 ft: Very pale brown (10YR 7/3), very dense		
222.3	103.6	9	21	36						SS-21			98.6 ft: Light brownish gray (10YR 6/2), some mica		
217.3	108.6	37	48	52/0.3						SS-22		223.9	WEATHERED ROCK: Severely weathered BIOTITE GNEISS (Sampled as Silty SAND (SM), dark yellowish brown (10YR 4/4), very dense, fine to medium grained sand, some mica, few to little rock fragments)		
212.3	113.6	44	56/0.2							SS-23			108.6 ft: Dark olive gray (5Y 3/2)		
207.3	118.6	50/0.1								SS-24					
202.3	123.6	50/0.2								SS-25			118.6 ft: Light olive brown (2.5Y 5/4)		
197.3	128.6	50/0.2								SS-26					
192.3	133.6	50/0.1								SS-27					
187.3	138.6	50/0.1								SS-28			133.6 ft: No recovery		
182.3	143.6	50/0.1								SS-29			138.6 ft: No recovery		
177.3	148.6	100/0.1								SS-30			143.6 ft: No recovery		
		50/0.1								SS-31		177.2	148.7		

NORTH ANNA 3 BORE NORTH ANNA 3 PROJECT.GPJ NORTH ANNA 3.GDT 12/4/09



SHEET 3 OF 3

BECHTEL PROJECT NO.: 25161			MACTEC PROJECT NO.: 6468-09-2473			COUNTY: Louisa, VA			GEOLOGIST: C. Baldwin					
SITE DESCRIPTION: North Anna 3 Project Supplement 2						DRILLER: P. Pitts/J. Tucker			FLUID LEVEL (ft)					
BORING NO.: M-11			DRILL METHOD: Mud Rotary			DRILL MACHINE: CME-55 Trailer (RAL)			0 HR. ND					
GROUND ELEV.: 325.9 ft (NAVD88)			NORTHING: 3,909,352 US ft (NAD83)			EASTING: 11,686,039 US ft (NAD83)			24 HR. ND					
TOTAL DEPTH: 148.7 ft			SAMPLE METHODS: ASTM D 1586-08a; 2488-09a; 2113-08; 6032-08			ROD TYPE: AWJ			HAMMER (ID):140-lb. Auto (MEC-425)					
DATE STARTED: 9/1/09			COMPLETED: 9/4/09			HOLE DIA.: 3"			CASING DEPTH: 8.4 ft					
CORE SIZE: NA			BITS USED: 2-7/8" Tri-Cone											
ELEV. (ft)	DEPTH (ft)	BLOW COUNT			BLOWS PER FOOT						SAMP. NO.	LOG	SOIL AND ROCK DESCRIPTION	
		0.5ft	0.5ft	0.5ft	0	20	40	60	80	100		MOI		
176.3					Continued from previous page									
														148.6 ft: No recovery Boring terminated at 148.7 feet.
														Boring closed by tremie method with cement-bentonite grout.
														Note: Boring terminated prior to 150 depth was reached after discussion with Bechtel Site Representative.

NORTH ANNA 3 BORE NORTH ANNA 3 PROJECT.GPJ NORTH ANNA 3.GDT 12/4/09